



Tel +46 415 164 00

Fax +46 415 164 01

E-mail info@exirtelecom.com

Homepage www.exirtelecom.com

Installation Instruction

Optimal electrical performance and minimized connection times can be achieved by having highly skilled Exir Telecom representatives train your installation crews. Exir Broadcasting & Telecom disclaims any liability as a result of improper or unsafe practice.

Document Id: 7160-F158-MD00

ver. 4

Rev. 081003 MXN

2 1/4" FOAM CONNECTORS

- 716f-F214-AB00
- 716m-F214-AB00,
- 00Nf-F214-AB00
- 00Nm-F214-AB00

Using connecting kit
CONK-F214-AA00

For 2 1/4" foam cables:
NK Cables RF 2 1/4" -50
Eupen EC-12-50 5528
Andrew LDF12-50

Required tools:

- Tool-kit CONK-F214-AA00




- 1** Use the cutting tool to cut the jacket.



- 2** Rotate the tool clockwise more than 1 turn. After rotating the tool and a cut has been made, remove the jacket with a knife, so the corrugation becomes visible.




- 3** Put the steering edge of the cutting tool in a valley. After turning the tool and a cut has been made, remove the jacket with a knife.

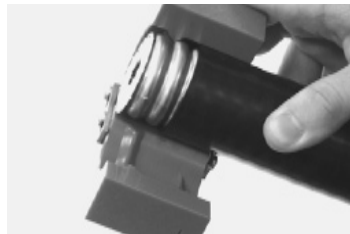


- 4** Put the cutting jig onto the cable so that it rests against the plastic. Use a hacksaw to cut the cable.




- 5** Make sure there has been a flush cut, on the top of a corrugation ridge.

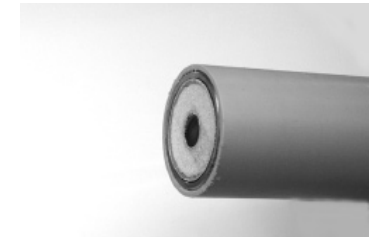

- 6** Remove burrs from the inner and outer conductors with a knife.

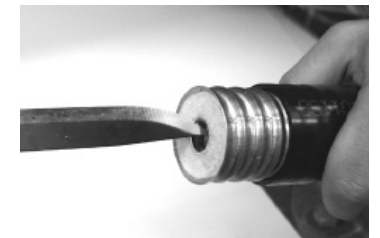

- 7** Check length.

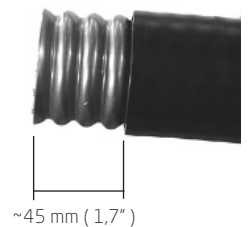



Tel +46 415 164 00
Fax +46 415 164 01
E-mail info@exirtelecom.com
Homepage www.exirtelecom.com

Installation Instruction

Optimal electrical performance and minimized connection times can be achieved by having highly skilled Exir Telecom representatives train your installation crews. Exir Broadcasting & Telecom disclaims any liability as a result of improper or unsafe practice.

Document Id: 7160-F158-MD00 ver. 4 Rev. 081003 MXN

2 1/4" FOAM CONNECTORS

- 716f-F214-AB00
- 716m-F214-AB00,
- 00Nf-F214-AB00
- 00Nm-F214-AB00

Using connecting kit
CONK-F214-AA00

For 2 1/4" foam cables:
NK Cables RF 2 1/4" -50
Eupen EC-12-50 5528
Andrew LDF12-50

- 8** Use the knife to push the dielectric foam away from the outer conductor and make sure there is some free space.



- 9** Remove burrs with a knife or file at the outside of the outer conductor.



- 10** Make sure no shavings are at the inner of the conductor. Remove burrs.



- 11** Use your thumb as a mark to know how far you need to push the connector onto the cable.



- 12** Make sure that the conductor is properly fitted.



- 13** Tighten the inner conductor clock wise by using a hook spanner on the front piece. Turn it 1.5 more rotations. This is the same as 6 - 8 Nm.



- 14** Remove the distance ring.



- 15** Tighten the connector clock wise, **without turning the front piece.**

The connector is now installed.

